VS-23/Meyer Baugruppe/Group: 23 Weltweit Datum/Date: all countries 02/2004

23 01 04 (063)

Gear lever sticks in 5th/reverse gear shift gate

E36/7, E38, E39, E46, E53 with GS5-280Z/320Z (C-transmission) and GS5-39DZ (F-transmission)

Complaint:- It is difficult to move the gear lever into and out of the 5th /reverse gear shift gate.

- The gear lever does not automatically move from the 5th/reverse gear shift gate back

to the centre position

- No shift gate guidance

Cause: Selector shaft locking pin sticking in bearing bush.

Affected E46 M47, M57

vehicles: E46 M52/B28, M54/B30

E39 M47, M57

E39 M52/B25, M54/B25 Touring E39 M52/B28, M54/B30, M62/B35

E53 M54/B30, M57

E36/7 M52/B28, M54/B30 E36/7 S50 and S54

E38 M51, M52/B28, M62/B35

Manufacturing period: September 1997 to December 2002

Remedy: Replace 5th and reverse gear locking pin bearing bushes.

Note:

In series production, improved bearing bushes were introduced in January 2003.

Procedure: In case of customer complaint, the 5th/reverse gear locking pin bearing bushes must be

replaced as described in Repair Instructions

23 11 565 (C-transmission) and 23 11 566 (F-transmission)

Note:

The transmission must be removed to replace the bearing bushes.

Special tools 23 4 021 , 23 4 022 and 23 4 023 are needed to perform the

repair.

Parts:

Part number: Part description: Quantity:

23 11 7 542 726 Repair kit for bearing bushes

Reimbursement: Material and labour costs incurred can be claimed through the usual warranty channels

subject to current warranty terms.

Defect code 23 00 92 34 00

This defect code is not contained in the official Defect Code Catalogue but has been included in the system, thus enabling warranty claims to be processed.

processeu.

Within the framework of a visit to the workshop -

Replace locking pin bearing bushes:

Job number 00 54 939

Labour The flat rates had not been defined at close of

press, but will shortly be available in the warranty system, thus enabling warranty claims to be

processed.

In case of order without additional repair

operations -

Replace locking pin bearing bushes

Job number 00 54 250

Labour The flat rates had not been defined at close of

press, but will shortly be available in the warranty

system, thus enabling warranty claims to be

processed.

Warranty type 1

Warranty stage 1 (within vehicle warranty)

2 (outside vehicle warranty)

It is only permitted to make a claim for reimbursement under one of the above job numbers.

Reimbursement is limited to **48 months** / **100,000 km** and only possible until **December 2006**.